



HUNTER Xci POLYISOCYANURATE OVER AIR/VAPOR BARRIER INSTALLATION GUIDELINES

HUNTER
CONTINUOUS INSULATION

XCI 15

Pipe and Penetration Flashing Mechanical/Electrical/Pipe Penetrations

- 1 Verify air/vapor/water resistive barrier is properly installed and a pinhole void free application has been achieved around all mechanical and electrical boxes. Report any deficiencies and ensure applicable repairs are conducted prior to Hunter Xci polyiso installation.
- 2 Rub the face of the mechanical/electrical box with chalk, place the Hunter Xci polyiso into place and thump the face. The profile of the box will be left on the facing. Cut along the marks and mechanically or adhesively attach the Hunter Xci polyiso as previously outlined.
- 3 Fill gaps greater than 1/8" between insulation boards with expanding spray foam or butter edge of board with approved sealant and strike flush. Expanding spray foam may also be applied onto the insulation board edges during installation.

